M. K. JUCHHEIM GmbH & Co

Delivery address: Mackenrodtstraße 14. 36039 Fulda, Germany Postal address: 36035 Fulda, Germany +49 661 60 03-0 Phone: +49 661 60 03-6 07 Fax: E-mail: mail@jumo.net Internet: www.jumo.net

JUMO Instrument Co. Ltd.

JUMO House Temple Bank, Riverway Harlow, Essex CM 20 2TT, UK

Phone: +44 12 79 63 55 33 +44 12 79 63 52 62 Fax: E-mail: sales@jumo.co.uk

JUMO PROCESS CONTROL INC.

885 Fox Chase, Suite 103 Coatesville PA 19320, USA 610-380-8002 Phone: 1-800-554-JUMO 610-380-8009 Fax: E-mail: info@JumoUSA.com Internet: www.JumoUSA.com



Data Sheet 40.4387

Page

Pressure transmitter JUMO dTRANS p02 CERAMIC

Type 404387

General application

The JUMO dTRANS p02 CERAMIC pressure transmitter measures the gauge (relative) or absolute pressure in both corrosive and non-corrosive gases, vapors and liquids. The ceramic-based measuring system in this pressure transmitter operates on the principle of capacitive measurement. The output signal is a DC current that is proportional to the input pressure.

The display can show:

- pressure in 13 different dimensional units, measurement in % or scaled with a freely selectable unit, output current in mA
- sensor temperature in °C or °F
- measurement error, out-of-range measurement
- minimum and maximum pressures (peak-reading indicator)
- pressure and sensor temperatures can be shown simultaneously (on 2 lines)

The keys can be used to set up:

- start and end of measurement, with pressure input
- start and end of measurement, without pressure input (blind setting)
- damping or time constant
- current generator function
- output signal on error
- key inhibit
- reset min. and max. measurements (peak-reading indicator)
- density correction for different measurement media
- display of the media temperature in °C or °F

The JUMO dTRANS p02 CERAMIC pressure transmitter can also be operated through a HART® communicator, or a PC in conjunction with a HART® modem and the JUMO setup program running under Windows®.

Accessories

Setup program

Sales No. 40/00365072

The setup program for all instruments in the JUMO dTRANS p02 series has been created according to the VDI/VDE 2187 user interface. In conjunction with the HART® modem, the program enables convenient operation and parameter setting of the pressure transmitter from a PC.

HART[®] modem

Sales No. 40/00345666

The HART® modem forms the link between the JUMO dTRANS p02 pressure transmitter and the serial interface of a PC.

Technical data

Reference conditions

as per DIN 16086 and IEC 770/5.3

Nominal input range see Order details


(4 mA)

Range setting

The measurement range can be set from the keys on the pressure transmitter, by using the setup program or a HART® communicator as described below:

Start and end of the measurement range can be continuously adjusted within the nominal range. The span of the measurement should not be less than 10% of the nominal range.

-	Nominal range	*
//////	Span	//////
4	≻ Range	∢ ≻
S	itart	End







Displayable units

Input pressure: mH₂O, inH₂O, inHg, ftH₂O, mmH₂O, mm Hg, psi, bar, mbar, kg/cm², kPa, Torr, MPa; Measurement:

% or scaled with freely adjustable dimensional unit

Output current:

mΑ

Additional displays

Indication of the sensor temperature, minimum pressure, maximum pressure. Indication of overrange or error

Density correction

adjustable over the range from 0.100 to 5.000 kg/dm³

Overload limits see Order details

Bursting pressure

for all ranges: 150 bar

Parts in contact with the medium standard:

stainless steel, Mat. Ref. 1.4571 aluminium oxide Al₂O₃ (96%), FPM, others on request

Pressure connection see Order details

Output

 $4 - 20 \text{ mA burden} \le (U_B - 11.5 \text{ V}) / 0.022 \text{ A}$ burden with HART[®] : max. 1100Ω, min. 250Ω with HART[®] protocol V 5.3. Complies with the guidelines of the HCF (HART[®] Communication Foundation)

Burden error

< 0.1%

Zero offset / adjustment accuracy $\leq 0.01 \, \text{mA}$

Ambient temperature error

over the compensated temperature range from -20 to +85°C

zero: \leq 0.005% per °C typical, ≤0.01% per °C max. ≤ 0.005% per °C typical, span: ≤0.01% per °C max.

Deviation from characteristic

for limit point adjustment: \leq 0.1% of full scale of nominal range; as per DIN 16086

Hysteresis

≤ 0.02% of full scale

Reproducibility

 \leq 0.02% of full scale

Response time approx. 150msec without damping

Damping adjustable from 0 - 100 sec

Stability over 1 year \leq 0.1% of full scale (for nominal range, and under reference conditions as per IEC 770)

Supply voltage

11.5 - 36V DC Note: at least 17V DC (250 Ω) for communication using the HART[®] protocol.

Supply voltage error

 $\leq 0.1\%$ of full scale per 10V change (nominal supply voltage 24V DC)

Permissible ambient temperature

-40 to +85°C; as per DIN 16086 (it may be impossible to read the LCD display at temperatures below -20°C)

Storage temperature -40 to +85°C

Permissible temperature of medium -40 to +120°C

Electromagnetic compatibility (EMC) as per EN 61 326

Mechanical shock 50a/11msec

Mechanical vibration max. 5g over 10-2000Hz

Protection with connecting cable IP65 to EN 60529

Insulation resistance 100MΩ: 50V DC

Breakdown strength \geq 500 V_{eff.}

Housing

aluminium die-casting GDAISi12

Climatic conditions

 \leq 80% rel. humidity with condensation, annual mean

Electrical connection

clamping case with screwed cover, 2 poles and earthing terminal, plastic cable gland M20 x 1.5 for cable diameters 6 to 12 mm

Nominal position


ex-factory, upright vertical (pressure connection below) any operating position

Weight


approx. 1.5kg

HART[®] communication


between PC and pressure transmitter

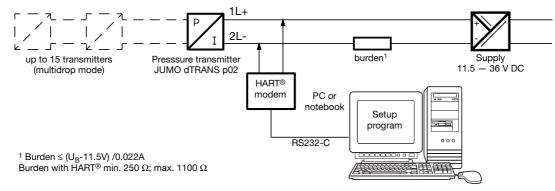


between HART® communicator and pressure transmitter



Dimensions

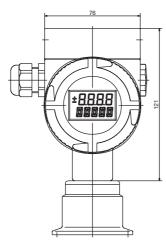

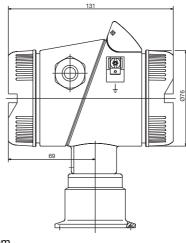


SW = a/f in mm G = pipe fitting in "


NTS 515

\$

SW 46

1/2-11 1/2 NPT



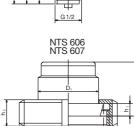

D₂

D,

D

NTS 504

DK-

SW27


7

8



Ø57

Ø64

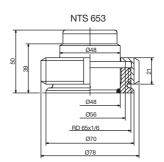

NTS	DN	D ₁	D ₂	D ₃	D_4	h ₁	h ₂
606	40	Ø48	Ø56	RD 65 x 1/6	Ø78	10	21
607	50	Ø61	Ø68.5	RD 78 x 1/6	Ø92	11	22


Electrical connection

Connection		Terminals
Supply 11.5 — 36 V DC, 11.5 — 30 V DC for intrinsically safe version		1 L+ 2 L-
Output 4 — 20 mA 2-wire	± ⊖►	1 L+ proportional current 4 – 20 mA 2 L- in supply
Test connection, current output	internal resistance of ammeter \leq 10 Ω	TEST + TEST -
Test connection, HART®		TEST + HART®
Shielding		

Caution:

Earth the instrument! (pressure connection and shielding)

Terminals

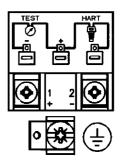

Order details

Basic type

404387			amittar dTDAN			oramic macauring system	
404367	Pressure transmitter dTRANS p02 CERAMIC with capacitive-ceramic measuring system Basic type extensions						
	~		be extensions				
	0	none		_			
			Nominal inpu	-			
		414	-100 to 100		gauge pressure	(overload limits -1 and 6 bar)	
		453	-0.6 to 0.6	bar	gauge pressure	(overload limits -1 and 10 bar)	
		457	-1 to 4	bar	gauge pressure	(overload limits -1 and 40 bar)	
		461	-1 to 25	bar	gauge pressure	(overload limits -1 and 60 bar)	
		487	0 to 0.6	bar	absolute pressure	(overload limits -1 and 10 bar)	
		491	0 to 4	bar	absolute pressure	(overload limits -1 and 40 bar)	
		495	0 to 25	bar	absolute pressure	(overload limits -1 and 60 bar)	
			Out	out			
			405 4 —	20 mA with H	HART [®] protocol		
					s connection		
			50	4 ¹ / ₂ " pip	e to EN 837		
			51	2	1 ¹ / ₂ NPT		
			57	2	pe to DIN 3852		
				606 taper connection with ring nut DN40 to DIN 11851			
				607 taper connection with ring nut DN50 to DIN 11851			
			616 clamp connection DN50 to DIN 32676				
	653 tank connection with ring nut DN40						
				Material for process connection			
					-		
				99 special material for process connection			
			Seal				
					601 FPM		
					604 FFPM on rec	u loat	
						ical connection	
						terminals	
					99 specia	l electrical connection	
404207				╶┑┎┸┑┍		aada	
404387 / 0 - 405 - Order code							

Factory setting:

Please specify the range to be set and the dimensional unit in plain text.